

Work Order ID 62312

September 27, 2010 8:00:33 AM



Page 1

Item ID: D206-667-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 9/27/10 Start Qty: 1.00



Cust Item ID:

Required Date: 10/15/10 Req'd Qty: 1.00



Customer:

Reference:

Run Start

Approvals: Process Plan: CL Date: 10/9/12 Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D206-667-243	Rev C								

100



DC

Document Control

DOCUMENT CONTROL

0.00

Memo

0.00

Photocopy bluefile and create labels as per PPP D206-667-203 CHG003

Sub 2/01

Handwritten: DP BG 11-02-1
~~DP 11-1-7~~

110



CNC Bend 2

CNC Alpha 160 Bender

BENDING MACHINE - CROSSTUBES

0.00

Memo

0.00

Bend tube as per Dwg D206-667-243 using CNC bender program 206L-AF

Handwritten: DP 11-1-7

120



QC

Quality Control

QC15- Crosstube Dimensional Check

0.00

Memo

0.00

Sub 1/10

Handwritten: @

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 62312

September 27, 2010 8:00:33 AM



Page 2

Item ID: D206-667-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 9/27/10 Start Qty: 1.00



Cust Item ID:

Required Date: 10/15/10 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Stop



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130



Crosstubes

Crosstubes

Crosstubes

0.00

0.00

Memo

1-Drill pilot holes in tube using drill Jig DT8583 & DT8584 as per Dwg D206-667-243 and drill table DT8577. Locate hole #6 for towers as per QSI 10. Drill all (3) top holes.

2-Drill and Ream all holes in tube to finish size using drill Jig DT8583 & DT8584 as per Dwg D206-667-243 Check dimensions between holes on all four sides.

3-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.

4-Drill pilot holes using drill Jig DT8583 & DT8584 as per Dwg D206-667-243. Drill only the top (2) holes.

5-Drill & ream the top (2) holes to finish size using drill Jig DT8583 & DT8584 as per Dwg D206-667-243

6-Drill Fwd rivet holes using drill Jig-DT8789FWD as per Dwg D206-667-143. Note: Fwd side has 3x top holes.

7-Drill Aft rivet holes using drill Jig DT8789 as per Dwg D206-667-243.

8-C'sink holes as per Dwg D206-667-243.

9-Scribe part # and batch # using vibrating stylus as per Dwg D206-667-243 Inside of Cuff (Do not engrave on outside of tube)

10-Debur & Inspect for surface damage. Repair damage within limits as per

DP

11-1-10

SAD
11-01-12

O

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 62312

September 27, 2010 8:00:33 AM



Page 4

Item ID: D206-667-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 9/27/10 Start Qty: 1.00



Cust Item ID:

Required Date: 10/15/10 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170 	Outsource process - NDT per QSI038 4.1	0.00							
Outsource2	Memo	0.00							
Outsource process - NDT	Liquid Penetrant Inspection as per QSI 038Or Issue P/O: <u>13277</u> LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order								<u>CZ</u> <u>11/01/13</u> <u>(1)</u>
180 	Packaging	0.00							
Packaging	Memo	0.00							
Packaging	Ensure copy of NDT results attached to work order.								<u>P</u> <u>11/01/13</u> <u>(1)</u>
190 	QC5- Inspect part completeness to step on W/O	0.00							
QC	Memo	0.00							
Quality Control	Ensure results are as per Dwg D206-667-243								<u>mm</u> <u>11</u> <u>01</u> <u>14</u> <u>(1)</u>

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

September 27, 2010 8:00:33 AM



Abstract

[illegible]

Customer:



**Insp.
Stamp**

m 11. 01-14 ①

Finish Time: 12:30

8/11/02/01

Quality Control

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 62312

September 27, 2010 8:00:33 AM



Page 6

Item ID: D206-667-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 9/27/10 Start Qty: 1.00



Cust Item ID:

Required Date: 10/15/10 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

220

0.00



Crosstubes

Crosstubes

Memo

0.00

Crosstubes

1-Install nut plates as per Dwg D206-667-243.

ml 11 01 24 6

230

0.00



Skidtubes

Crosstubes

Memo

0.00

Crosstubes

1-Install support using 0.03" to 0.06" thick layer of magnobond 6398 per QSI 015. Let cure for 12h after installation and prior to packaging. Note: (3) top holes should be facing up.

A/R Magnobond 6398 : 116227 exp: 08/2011

2-Install supports and clamps as per Dwg D206-667-243. Torque clamps to 80-100 in lb

ml 11/02/01

ml 11 01 24 5

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 62312

September 27, 2010 8:00:33 AM



Page 7

Item ID: D206-667-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 9/27/10 Start Qty: 1.00



Cust Item ID:

Required Date: 10/15/10 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240 QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.00				(40)			
250 Packaging Packaging	Pick Kit Memo	0.00 0.00				40	SP		
260 QC Quality Control	QC4- 100% Inspect kits for completeness Memo	0.00 0.00				40			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 62312

September 27, 2010 8:00:33 AM



Page 8

Item ID: D206-667-203

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft

Start Date: 9/27/10 Start Qty: 1.00



Cust Item ID:

Required Date: 10/15/10 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
270 	Packaging	0.00							
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPP D206-667-203 Location: PPP Rev:								
280 	QC21- Final Inspection - Work Order Release	0.00							
QC	Memo	0.00							
Quality Control									

11/21/10

11/02/10

MF

11-02-01

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

September 27, 2010 8:00:33 AM

Page 1

Work Order ID: 62312

Parent Item: D206-667-203

Parent Item Name: Crosstube Aft



Start Date: 9/27/10

Required Date: 10/15/10

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:F 05.09.01 Add holes for compatibility with Bell Skidtubes KJ/JLM
 IPP Rev:G 08-06-03 update as per DSI9415 (ECN1198) DD verified by:ec
 IPP Rev:H 08-07-18 remove thread masking in step 12 DD verified by:EC
 IPP Rev:I 08-12-15 add magnobond DD verified by:EC
 IPP Rev J 09.01.06 ECN 08-562 EC verified by:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D206-667-203TRN		Manufactured	No			220	Each	2.0000	1	1			



Crosstube Turning Detail

Location	Loc Qty	Loc Code
LG	2	
61983	1	
62029	1	

D2873-043 Manufactured No



Nut Plate Assembly

Location	Loc Qty	Loc Code
LG	12	
57337	12	
ST	20	
60981	20	

D2873-045 Manufactured No



Nut Plate Assembly

Location	Loc Qty	Loc Code
LG	28	
57336	8	
60982	20	

B# 63497

B# 63498 x1

65132 x1 - 11.02.07

11-1-7
ml 10-01-24
ml 11-01-24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

September 27, 2010 8:00:33 AM

Work Order ID: 62312



Parent Item: D206-667-203



Parent Item Name: Crosstube Aft

Start Date: 9/27/10

Required Date: 10/15/10

Start Qty: 1.00

Required Qty: 1.00

D2892-1

Manufactured No

230

Each

44.0000

2

2



Support



11-01-24

Location

Loc Qty

Loc Code

LG

44

41986

12

42785

20

53124

8

55787

1

61631

3

D3595-063-450

Manufactured No

230

Each

123.6590

4

4



RUBBER CUSHION



11-01-24

Location

Loc Qty

Loc Code

LG

123.6589737

53775

5.97897368

58161

3.56

59580

10.12

60983

25

61465

79

MS20601-AD4W10

Purchased No

230

Each

116.0000

14

14



RIVET



11-01-24

Location

Loc Qty

Loc Code

LG051

102

114245

2

115405

100

ST322

14

113220

14

116186

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Page 3

September 27, 2010 8:00:33 AM

Work Order ID: 62312

Parent Item: D206-667-203

Parent Item Name: Crosstube Aft

Start Date: 9/27/10

Required Date: 10/15/10

Start Qty: 1.00

Required Qty: 1.00

MS21920-22

Purchased

No

230

Each

86.0000

4

4



Clamp(per MIL-DTL-8783C)



11.01.24

Location

Loc Qty

Loc Code

LG

86

114077

86

Purchased

No

250

Each

372.0000

10

10

AN5-10A



Bolt



11/21/10

Location

Loc Qty

Loc Code

ST337

372

115108

85

115429

50

115589

100

115700

137

Purchased

No

250

Each

332.0000

4

4

AN5-32A



Bolt



11/21/10

Location

Loc Qty

Loc Code

ST340

332

114056

72

114405

50

115016

50

115108

50

115589

60

115698

50

✓

September 27, 2010 8:00:33 AM

Shop Packet Print

Page 3

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Page 4

September 27, 2010 8:00:33 AM

Work Order ID: 62312



Parent Item: D206-667-203



Parent Item Name: Crosstube Aft

Start Date: 9/27/10

Required Date: 10/15/10

Start Qty: 1.00

Required Qty: 1.00

AN5-34A
Bolt
Purchased No

250 Each 72.0000



4

4

11/2/10

M116191

Location	Loc Qty	Loc Code
ST340	72	
113149	22	
113226	50	

AN960JD516
Washer
Purchased No

NAS1149D0563J

250 Each 34.0000



18

18

11/18/10

M118742

Location	Loc Qty	Loc Code
ST	34	
103694	18	
107534	12	
109287	4	

MS21042L5
Nut
Purchased No

250 Each 957.0000



4

4

11/2/11

4

Location	Loc Qty	Loc Code
ST139	26	
114813	26	
ST300	931	
115156	431	
115594	500	

September 27, 2010 8:00:33 AM

Shop Packet Print

Page 4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -243	Part Number	Description
1	X	D206-667-243	CROSSTUBE ASSEMBLY (206L HIGH AFT)
2	1	D6004-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2892-1	SUPPORT
6	4	D3595-063-450	RUBBER CUSHION
7	4	MS21920-22	CLAMP
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)


CX1019127
W/O: 62312

GENERAL NOTES:


- 1) MATERIAL: MANUFACTURED FROM D6004-115
FINISHED LENGTH = 104.91±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-243" AND BATCH NUMBER ON
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 21.9 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY,
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2892-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER
QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-22 CLAMPS WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE
D2892-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE
LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
08/11/06


C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-450 WAS D2856-400-773 (ZN D6-2 & A5-2); REMOVED REF. & ADD TOLERANCES (ZN 4-3, CS-3, D3-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKUDTUBES	PH	05.07.26
A	NEW ISSUE	CP	00.11.17
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF	DRAWING NO.	REV. C
CHECKED	RF	D206-667-243	SHEET 1 OF 4
MFG. APPR.	RF	TITLE	SCALE
APPROVED	RF	CROSSTUBE ASSY (206L HIGH AFT)	NTS
DE APPR.	RF	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	
DATE	08.11.06		

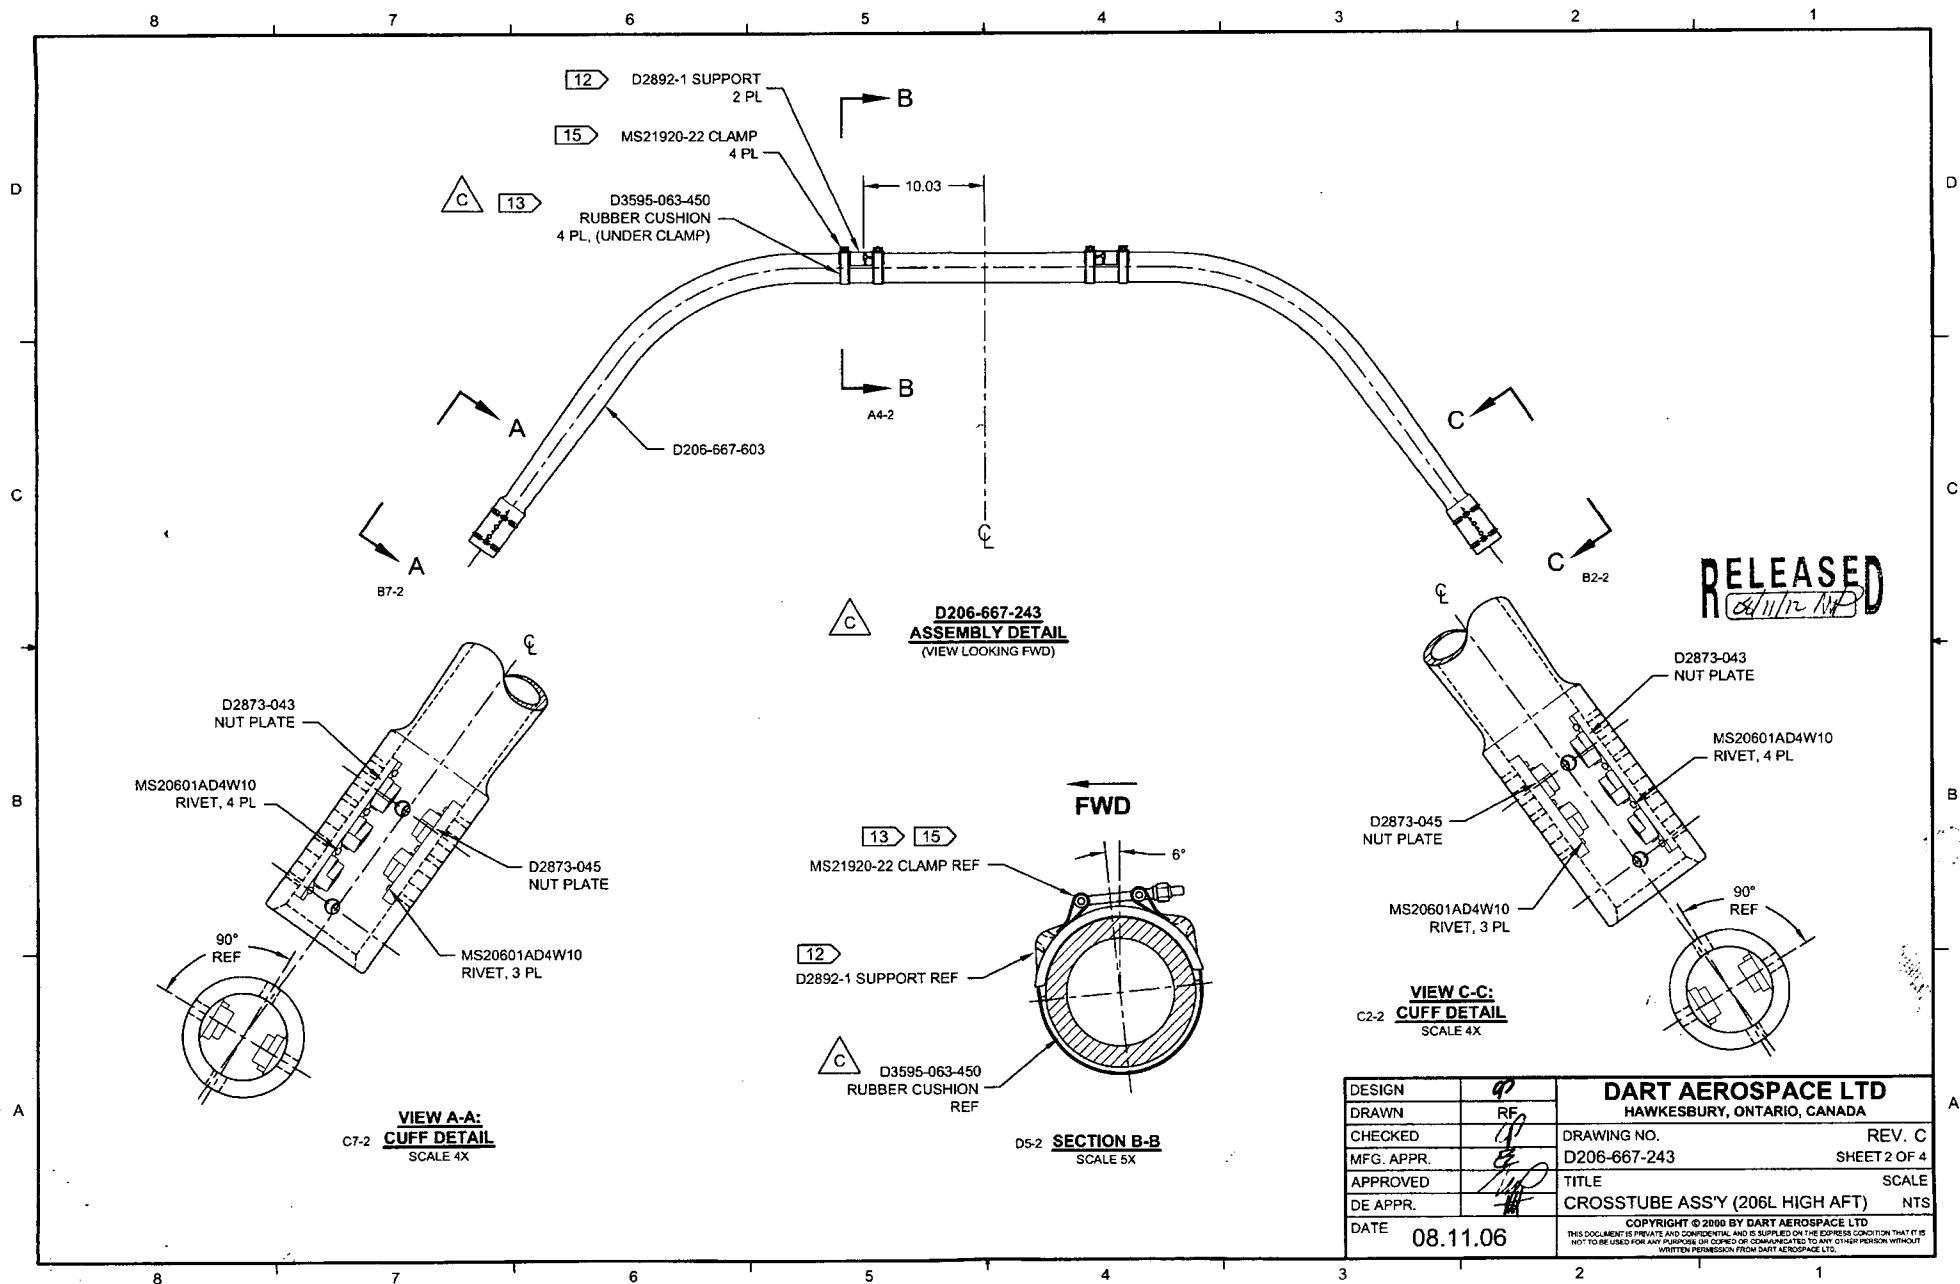

DESIGN	90	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	9	DRAWING NO.	REV. C
MFG. APPR.	9	D206-667-243	SHEET 2 OF 4
APPROVED	9	TITLE	SCALE
DE APPR.	9	CROSSTUBE ASS'Y (206L HIGH AFT)	NTS
DATE	08.11.06	<small>COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

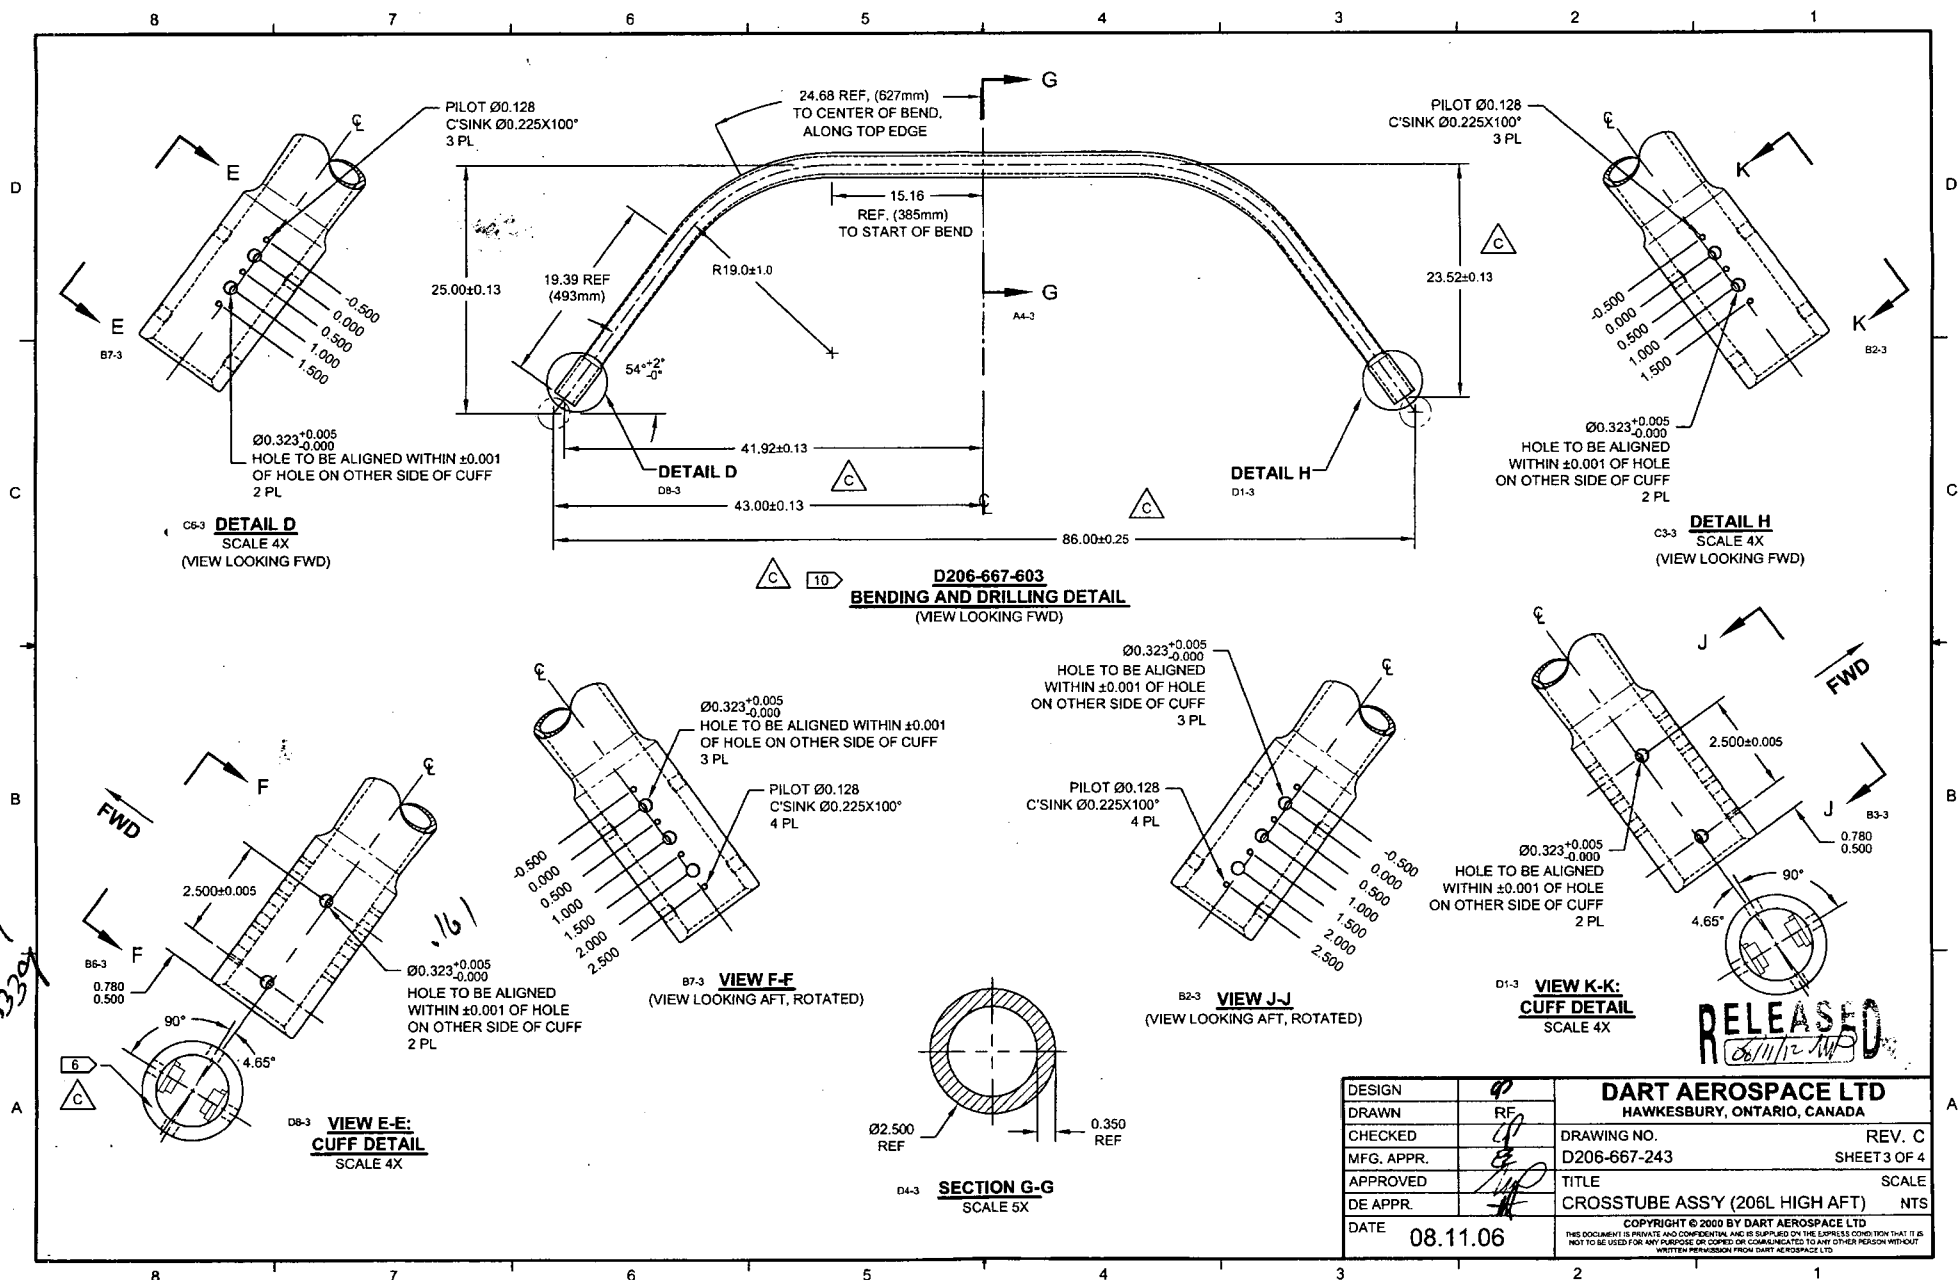


DESIGN	40	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	CP	DRAWING NO.	REV. C
MFG. APPR.	EP	D206-667-243	SHEET 3 OF 4
APPROVED	JP	TITLE	SCALE
DE APPR.	JP	CROSSTUBE ASS'Y (206L HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

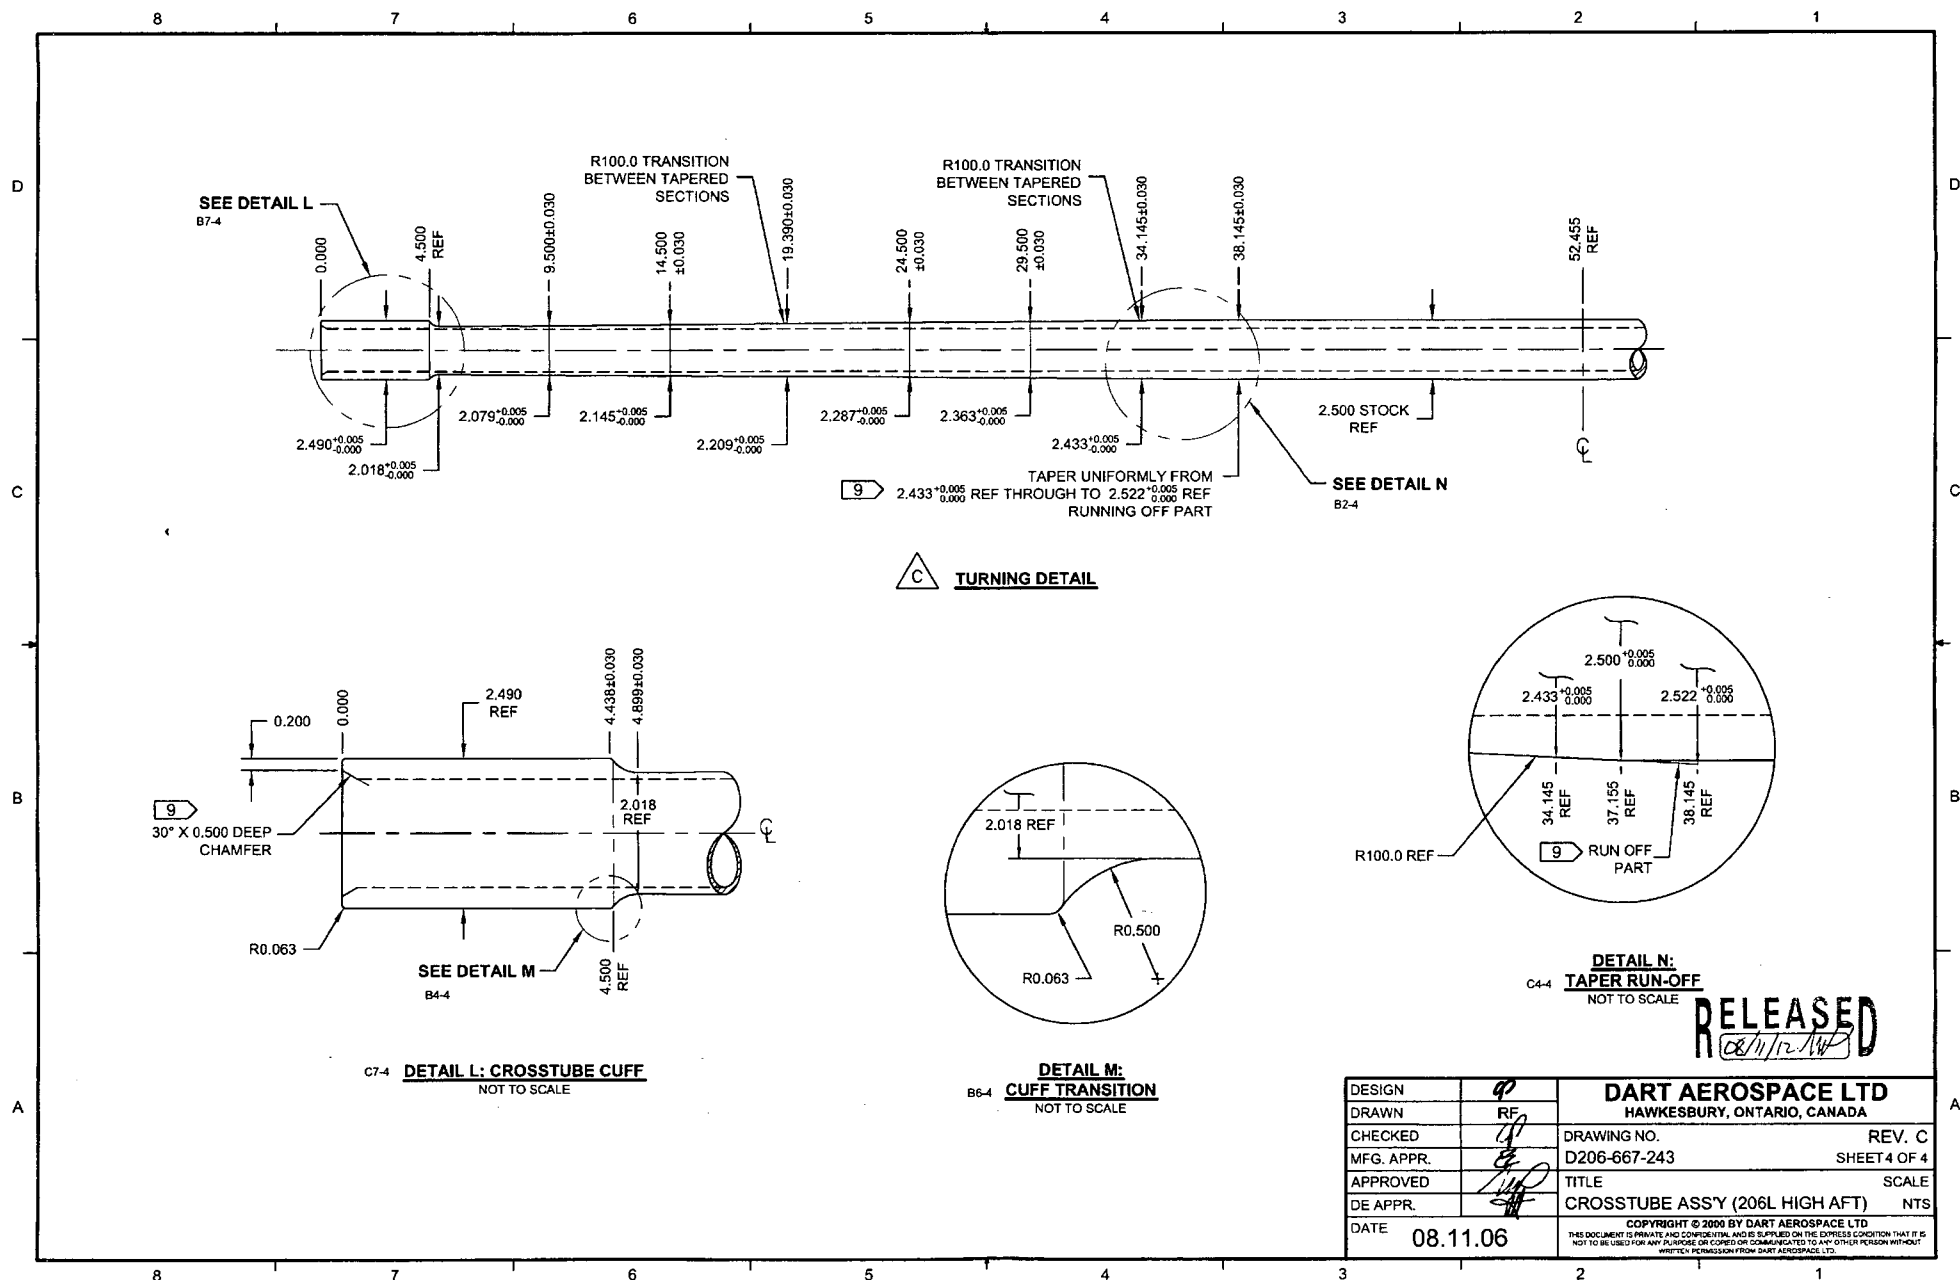

DART AEROSPACE LTD	Work Order:	62312
Description: Crosstube High Aft (206L)	Part Number:	D206-667-203
Inspection Dwg: D206-667-243 Rev: C		Page 1 of 1

Required Dimension	Min	Max
Height	23.39	23.65
1/2 Span	41.79	42.05
Angle	54	56
Total Span	83.58	84.1

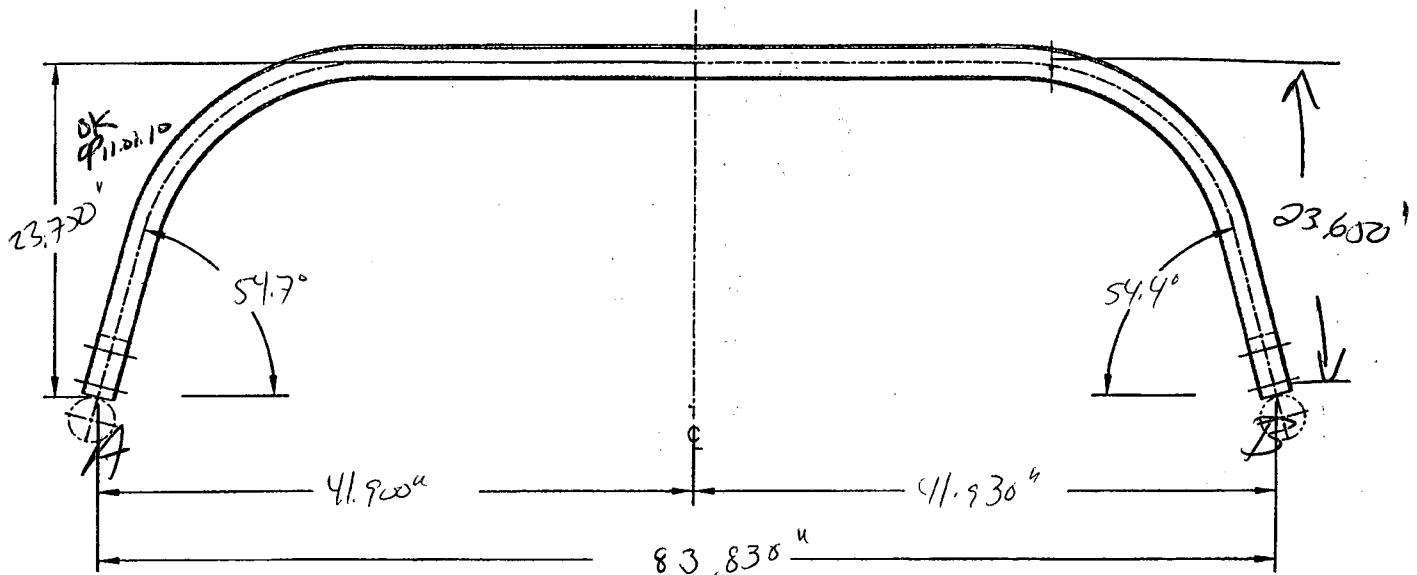

Comments
Height high on one side, Acceptable
11.01.10 / 051042

QC15 Inspection	
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	09.11.17	Dwg Rev updated	KJ	
C	09.12.14	Dimensions update per Dwg Rev C	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



ACUREN

LIQUID PENETRANT TEST REPORT

P- 05494

PAGE 1 OF 1
TIME AM ☒ PM ☐

CLIENT JART AEROSPACE
ATTENTION LINDA LAUREN/CHANTALE JIAN
ADDRESS 1270, ABERDEN
HAWKESBURY, ON
PROJECT F.P.I. ON 4 "CROSS-TUBES"
ITEM(S) EXAMINED SEE BELOW

DATE JAN/13/2011
ACUREN JOB No. 188-11-2012
PO/WO No. 13277
WORK LOCATION AS ADDRESS
ACCEPTANCE STD. ASTM A17/47-038 REV./DATE 2005

JOB DESCRIPTION
PROCEDURE No. LT 002 REV./DATE 2008 TECHNIQUE No. LT 002 REV./DATE 2008
PART No. MATERIAL ALODINE ALUMINUM THICKNESS N/A
SCOPE PERFORMED A WET-FLUORESCENT-LIQUID PENETRANT INSPECTION ON 100% OF THE EXTERNAL SURFACE

TEST DETAILS
METHOD ☒ FLUORESCENT ☐ VISIBLE ☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED
FAMILY BRAND MAGNAFLUX BLACK LIGHT S/N 13798 OUTPUT > 1000 μ W/cm² ☒ AMBIENT < 2 fc
PENETRANT 2K-67 MINIMUM DWELL TIME 10 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFACE
PENETRANT REMOVER H₂O MINIMUM DRY TIME > 10 MIN. OTHER
DEVELOPER SKD-52 MINIMUM DWELL TIME 10 MIN. LIGHT METER S/N CAL DUE DATE FEB-05-2011
DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY

TEST SURFACE
SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☐ MACHINED ☐ SHOT BLASTED ☒ CLEAN BARE METAL
SURFACE TEMPERATURE ☐ < -4°C/ 20°F ☐ -4°C/ 20°F TO 10°C/50°F ☒ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS- (<input type="checkbox"/> METRIC <input checked="" type="checkbox"/> IMPERIAL)		ACCEPT	REJECT
- WET-FLUO L.P.I. ON 100% EXTERNAL SURFACE -			
1	CROSS TUBE W.O. ID 63987	✓	
2	CROSS TUBE W.O. ID 63988	✓	
3	CROSS TUBE W.O. ID 62311	✓	
4	CROSS TUBE W.O. ID 62312	✓	

NO REJECTABLE INDICATION WAS DETECTED AS PER APPLICABLE STANDARD

ITEM ID: - D212-664-101 (ITEM #1,2)
- D206-667-203 (ITEM #3,4)
11 01 14

Scope of Services
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES
CLIENT REPRESENTATIVE Tam Tiley PRINT Tam Tiley SIGNATURE
TECHNICIAN (SIGNATURE): YVES DESROSIERS PRINT YVES DESROSIERS SIGNATURE
NAME (PRINT):
CGSB LEVEL 2 SNT LEVEL 2 CGSB LEVEL — SNT LEVEL —
CGSB REG. No. 3049 CGSB REG. No. —

DTR # E44833
REPORT
REVIEWED BY: NAME INITIALS

5.0 PARTS LIST

Item	Qty -011	Qty -013	Qty -015	Qty -101	Qty -201	Qty -103	Qty -203	Qty -105	Qty -205	Part Number	Description
	X									D206-667-011	SPACER BLOCK KIT
		X								D206-667-013	NUT PLATE KIT (-101/-103/-105/-203/-205)
			X							D206-667-015	NUT PLATE KIT (-201)
				X						D206-667-101	CROSSTUBE INSTALLATION, 206A/B HIGH FWD
					X					D206-667-201	CROSSTUBE INSTALLATION, 206A/B HIGH AFT
						X				D206-667-103	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH FWD
							X			D206-667-203	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH AFT
								X		D407-667-105	CROSSTUBE INSTALLATION, 407 HIGH FWD
									X	D407-667-205	CROSSTUBE INSTALLATION, 407 HIGH AFT
1				1						D206-667-141	CROSSTUBE ASSEMBLY, 206A/B HIGH FWD
2					1					D206-667-241	CROSSTUBE ASSEMBLY, 206A/B HIGH AFT
3						1				D206-667-143	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH FWD
4							1			D206-667-243	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH AFT
5								1		D407-667-145	CROSSTUBE ASSEMBLY, 407 HIGH FWD
6									1	D407-667-245	CROSSTUBE ASSEMBLY, 407 HIGH AFT
10				*2	*2	*2		*2		D2891-1	SUPPORT
11							*2			D2892-1	SUPPORT
12									*1	D2894-1	SUPPORT
13				*2	*2	*2		*2		D2856-400-694	ABRASION STRIP
14							*2		*2	D2856-400-773	ABRASION STRIP
15									*1	D2856-600-851	ABRASION STRIP
16				*4	*4	*4		*4		MS21920-20	CLAMP
17							*4		*4	MS21920-22	CLAMP
18									*2	MS21920-24	CLAMP
19				4	4	4		4		AN5-32A	BOLT
20							4		4	AN5-34A	BOLT
21				4	4	4	4	4	4	MS21042L5	NUT (OR MS21042-5)
22				8	8	8	8	8	8	AN960JD516	WASHER
23									*2	D3190-1	CHAFING SHIELD
30	8									AN4-6A	BOLT
31	8									AN4-7A	BOLT
32	16									AN960JD416	WASHER
33	2									D3193-041	SPACER BLOCK ASSEMBLY
40		2		*2		*2	*2	*2	*2	D2873-043	NUT PLATE
41		2		*2		*2	*2	*2	*2	D2873-045	NUT PLATE
42			2		2					D2872-043	NUT PLATE
43			2		2					D2872-045	NUT PLATE
44		10		10		10				AN5-7A	BOLT
45		10	10		10		10	10	10	AN5-10A	BOLT
46		4	4	4	10	4		4		AN5-30A	BOLT
47		4					4		4	AN5-32A	BOLT
48		18	18	10	12	10	10	10	10	AN960JD516	WASHER
49		4	4		6					MS21042L5	NUT (OR MS21042-5)

*REFERENCE ONLY. PARTS ARE INCLUDED IN D206-667-141/241/143/243, & D407-667-145/245 ASSEMBLIES ABOVE

• COPYRIGHT © 2001 BY DART AEROSPACE LTD. •

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Revision: C

Date: 05.07.26